

Combined Sewer Overflow (CSO) Long-Term Control Plan Consent Decree

Case 1:10-CV-02895-DCN

Semi-Annual Progress Report No. 1

July 24, 2012



July 24, 2012

Chief, Environmental Enforcement Section Environmental and Natural Resources Division U.S. Department of Justice Box 7611 Ben Franklin Station Washington, D.C. 20044-7611

Chief, Water Enforcement and Compliance Assurance Branch U.S. Environmental Protection Agency Region 5 77 West Jackson, Blvd. Mail Code C-15WC Chicago, IL 60604-3590 Nicole Cantello
Associate Regional Counsel
U.S. Environmental Protection Agency
Region 5
77 West Jackson Blvd., Mail Code C14J
Chicago, IL 60604—3590

Chief, Environmental Enforcement Section Office of the Ohio Attorney General 30 East Broad Street, 25th Floor Columbus, Ohio 43215-3400

Chief, Division of Surface Water Ohio Environmental Protection Agency 50 West Town Street, Suite 700 Columbus, Ohio 43215

Re: Consent Decree Case 1:10-CV-02895-DCN Semi-Annual Progress Report No. 1

To Whom It May Concern:

The NEORSD is pleased to submit the enclosed Semi-Annual Progress Report (Progress Report) pursuant to Section IX of the above referenced Consent Decree. This Progress Report covers the period from Consent Decree Entry, July 7, 2011, through June 30, 2012.

Sincerely,

Julius Ciaccia
Executive Director

Cc: M. Sundheimer K. Rotunno

D. Marshall/Project Clean Lake File

TABLE OF CONTENTS

- 1. Current Reporting Period Consent Decree Requirements (IX. Paragraph 46.a.)
- 2. Current Work and Next Reporting Period Projected Work (IX. Paragraph 46.b.)
- 3. Current Reporting Period Consent Decree Submissions (IX. Paragraph 46.c.)
- 4. Certification Statement (IX. Paragraph 48)

APPENDIX: Current CSO and Bypass Reports Submitted to OEPA (IX. Paragraph 46.d.).

1. Current Reporting Period Consent Decree Requirements (IX. Paragraph 46.a.)

"A statement setting forth the deadlines and other terms that NEORSD is required by this Consent Decree to meet since the date of the last Semi-Annual Progress report, whether and to what extent NEORSD has met these requirements, and the reasons for any noncompliance".

Table 1: Current Reporting Period CD Requirements

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Compliance Status
Consent Decree Paragraph 18.A.(2)/ Appendix 1 Control Measure 2	Treatment and Disinfection of CSO 001 Using CEHRT	Pilot Work Plan submitted by January 1, 2011	January 1, 2011	In compliance: Work Plan submitted December 28, 2010. Comments received from US EPA March 1, 2011. Revised Work Plan submitted April 14, 2011. Comments received from US EPA July 27, 2011. Amendment to revised Work Plan submitted August 30, 2011. US EPA Approval Letter dated September 20, 2011 was received on September 23, 2011.
Consent Decree Paragraph 18.A.(2)/ Appendix 1 Control Measure 3	Treatment and Disinfection of CSO 002 using CEHRT in all 6 Quadrants (quads)	Pilot Work Plan submitted by January 1, 2011	January 1, 2011	In compliance: Work Plan submitted December 28, 2010. Comments received from US EPA March 1, 2011. Revised Work Plan submitted April 14, 2011. Comments received from US EPA July 27, 2011. Amendment to revised Work Plan submitted August 30, 2011. US EPA approval letter dated September 20, 2011 was received on September 23, 2011.

Table 1: Current Reporting Period CD Requirements

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Compliance Status
Consent Decree Paragraph 18.A.(2)/ Appendix 1 Control Measure 4	Treatment of Primary Effluent Bypass Demonstration/Pilot Project	Pilot Work Plan submitted by January 1, 2011	January 1, 2011	In compliance: Work Plan submitted December 28, 2010. Comments received from US EPA March 1, 2011. Revised Work Plan submitted April 14, 2011. Comments received from US EPA July 27, 2011. Amendment to revised Work Plan submitted August 30, 2011. US EPA Approval Letter dated September 20, 2011 was received on September 23, 2011.
Consent Decree Paragraph 16.a/ Appendix 1 Control Measure 6	Euclid Creek Tunnel/Dugway Storage System	Bid Year 2010	December 31, 2010	In compliance: Euclid Creek Tunnel Project bid date October 21, 2010.

Table 1: Current Reporting Period CD Requirements

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Compliance Status
Consent Decree Paragraph 19/ Appendix 3	Green Infrastructure (GI) Plan to achieve a minimum of 44 MG of additional CSO control in a Typical Year	GI Plan Submitted by December 31, 2011	December 31, 2011	In compliance: GI Plan submitted December 28, 2011. Comments received from US and Ohio EPA January 30, 2012. Revised GI Plan and written responses to EPA's comments submitted March 1, 2012. US and Ohio EPA Approval with Conditions Letter was received on March 30, 2012. GI Plan updated as required in EPA Approval with Conditions Letter and re-submitted to EPA on April 25, 2012.
Consent Decree Paragraph 26/ Appendix 5	Federal Supplemental Environmental Project — Collection and Disposal of Household Hazardous Waste at Special Waste Convenience Center or Alternative Location	Commencement of monthly collection and disposal activities no later than April 2011	April 30, 2011	In compliance: On March 24, 2011, the NEORSD and Cuyahoga County Solid Waste District (CCSWD) entered into an intergovernmental agreement for the collection and disposal of Household Hazardous Waste. First collection was held on April 28, 2011 with 28 collections in total occurring through June 30, 2012. To date, the District has expended \$143,993.52.

Table 1: Current Reporting Period CD Requirements

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Compliance Status
Consent Decree Paragraph 36/ Appendix 6	State Supplemental Environmental Project – Canal Pump Station Operation and Maintenance	Commence operation and maintenance of pump station following completion of Canal Pump Station construction Or Payment of \$800,000 to USEPA within sixty (60) days after NEORSD receives notice from OEPA that the Canal Diversion Dam Removal will not be implemented, or by January 31, 2012 whichever occurs later	TBD	In compliance: Environmental Impact Statement for Canal Diversion Dam Removal not scheduled to be completed until 3 rd Quarter 2013.

Table 1: Current Reporting Period CD Requirements

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Compliance Status
Consent Decree Appendix 2 Section 2.6.2	Progress Reports to the Public	Public outreach activities will continue with periodic updates using various media	N/A	In compliance: A web page on the District's internet website dedicated to the CSO Long Term Control Program (branded Project Clean Lake by the District) has been established. Includes but is not limited to project status information for all active CSO LTCP projects. www.neorsd.org/projectcleanlake.php Posting of EPA Approved GI Plan on District's internet website. CSO LTCP project updates posted on District blog (http://neorsd.blogspot.com) Production of printed materials as needed for public education events. Project Clean Lake banners are displayed at two locations of the Euclid Creek Tunnel project to help customers relate that work to the District's CSO LTCP efforts.

2. Current Work and Next Reporting Period Projected Work (IX. Paragraph 46.b.)

"A general description of the work completed within the Six-month Period, and a projection of work to be performed pursuant to this Consent Decree during the next or succeeding Six-month Period. Notifications to the U.S. EPA and Ohio EPA of any anticipated delay shall not, by itself, excuse the delay".

Table 2a: Description of this Reporting Period's Current Work

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Current Period Work Summary
CD Paragraph	Green Infrastructure (GI) Plan to	Submit a Green	December 31, 2011	Green Infrastructure (GI) Plan submitted on
19/Appendix 3	achieve a minimum of 44 MG of	Infrastructure Plan by		December 28, 2011. Subsequent presentation on
	additional CSO control in a Typical	December 31, 2011		the Plan was provided to USEPA representatives on
	Year			January 13, 2012. EPA approval of plan was
				received on March 30, 2012.

Table 2a: Description of this Reporting Period's Current Work

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Current Period Work Summary
Appendix 3	Implementation of GI Plan	Implementation of GI Plan within eight (8) years of Entry of Decree	July 7, 2019	A Green Infrastructure (GI) Advanced Planning and Early Action Project commenced on March 16, 2012. December 9, 2011 entered into contract with University Circle Inc. for construction of green infrastructure features at the Courtyard by Marriott Hotel. Hotel construction commenced December 2011. May 3, 2012 Board resolution passed authorizing District to enter in to cooperative agreement with the City of Cleveland on the Fleet Avenue Reconstruction/Green Infrastructure Project for \$1,000,000 for the construction, maintenance, inspection and operation of green infrastructure components of the street project. June 22, 2012 Cleveland Foundation approved \$400,000 to support green infrastructure partnership of NEORSD, Cleveland Foundation, and LANDStudio, a non-profit design and public art organization.
Appendix 1 Control Measure 1	Easterly WWTP - Increase Secondary Treatment Capacity	Bid Year: 2014 Achievement of Full Operation: 2016	December 31, 2014 December 31, 2016	Easterly Secondary System Improvements project which will increase secondary capacity to 400 MGD commenced design. Design Notice to Proceed (NTP) was issued on November 3, 2011 and as of June 30, 2012 is at approximately 30% design.

Table 2a: Description of this Reporting Period's Current Work

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Current Period Work Summary
Appendix 1 Control Measure 2	Treatment and Disinfection of CSO 001 Using CEHRT	Pilot Testing Report within 42 months of Work Plan Approval	March 20, 2015	Bids were received on June 19, 2012 for the construction of both the CSO 001(CM 2) and CSO 002 (CM 3) pilot facilities. Due to bid irregularities, re-bid of the construction was required and is scheduled for July 9, 2012.
Appendix 1 Control Measure 3	Treatment and Disinfection of CSO 002 using CEHRT in all 6 Quadrants (quads)	Pilot Testing Report within 54 months of Work Plan Approval	March 20, 2016	Bids were received on June 19, 2012 for the construction of both the CSO 001(CM 2) and CSO 002 (CM 3) pilot facilities. Due to bid irregularities, re-bid of the construction was required and is scheduled for July 9, 2012.
Appendix 1 Control Measure 4	Southerly WWTP - Treatment of Primary Effluent Bypass Demonstration/Pilot Project	Pilot Testing Report within 42 months of Work Plan Approval	March 20, 2015	Bids were received on June 14, 2012 for the construction of the pilot facilities.

Table 2a: Description of this Reporting Period's Current Work

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Current Period Work Summary
Appendix 1 Control Measure 6	Euclid Creek Tunnel/Dugway Storage System	Bid Year 2010 Achievement of Full Operation 2020	December 31, 2010 December 31, 2020	Dugway East Interceptor Relief Sewer: Project construction was completed. Euclid Creek Tunnel: Construction commenced in April 2011. Easterly Tunnel Dewatering Pump Station (TDPS): Construction commenced in January 2012. Dugway West Interceptor Relief Sewer: 60% design submittal was received in April 2012. Euclid Creek Pump Station/Lakeshore Boulevard Relief Sewer (ECPS/LBRS): Project commenced design in January 2012.
Appendix 1 Control Measure 24	CSO 063 Relief/Consolidation Sewer	Bid Year 2013 Achievement of Full Operation 2014	December 31, 2013 December 31, 2014	A Request for Proposal (RFP) for project design was issued in May 2012 and proposals were received on June 29, 2012.

Table 2b: Description of Next Reporting Period's Projected Work

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Next Period Projected Work
Appendix 3	Implementation of GI Plan	Implementation of GI Plan within eight (8) years of Entry of Decree	July 7, 2019	The Green Infrastructure (GI) Advanced Planning and Early Action Project is scheduled to be complete in March 2013. Courtyard by Marriott Hotel construction expected complete end of 2012, pervious pavement installation anticipated November 2012. Fleet Avenue Reconstruction/Green Infrastructure Project engineering and design anticipated complete by end of 2013 and construction completed by end of 2014. Primary Partnership Agreement between NEORSD, Cleveland Foundation, and LANDStudio anticipated executed by September 2012. Continue to evaluate projects and develop cooperative agreements for project implementation.
Appendix 1 Control Measure 1	Increase Secondary Treatment Capacity	Bid Year: 2014 Achievement of Full Operation: 2016	December 31, 2014 December 31, 2016	Project design is scheduled to be complete in May 2013.

Table 2b: Description of Next Reporting Period's Projected Work

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Next Period Projected Work
Appendix 1 Control Measure 2	Treatment and Disinfection of CSO 001 Using CEHRT	Pilot Testing Report within 42 months of Work Plan Approval	March 20, 2015	Construction Notice to Proceed (NTP) is scheduled for September 2012. Construction is scheduled to be complete 180 days after NTP.
Appendix 1 Control Measure 3	Treatment and Disinfection of CSO 002 using CEHRT in all 6 Quadrants (quads)	Pilot Testing Report within 54 months of Work Plan Approval	March 20, 2016	Construction Notice to Proceed (NTP) is scheduled for September 2012. Construction is scheduled to be complete 240 days after NTP.
Appendix 1 Control Measure 4	Treatment of Primary Effluent Bypass Demonstration/Pilot Project	Pilot Testing Report within 42 months of Work Plan Approval	March 20, 2015	Construction Notice to Proceed (NTP) is scheduled for August 2012. Construction is scheduled to be complete 240 days after NTP.

Table 2b: Description of Next Reporting Period's Projected Work

Reference	Description	Milestone(s) in CD	Calendar Milestone(s)	Next Period Projected Work
Appendix 1 Control Measure 6	Euclid Creek Tunnel/Dugway Storage System	Achievement of Full Operation 2020	December 31, 2020	Euclid Creek Tunnel: Construction commenced in April 2011 and is scheduled to be complete in 2015. Easterly Tunnel Dewatering Pump Station (TDPS): Construction commenced in January 2012 and is scheduled to be complete in 2015. Dugway West Interceptor Relief Sewer: Design is scheduled to be complete by November 2012. Euclid Creek Pump Station/Lakeshore Boulevard Relief Sewer (ECPS/LBRS: Design is scheduled to be complete by May 2013. Dugway Storage Tunnel (DST): A Request for Proposal (RFP) for project design is scheduled to be issued by the end of August 2012.
Appendix 1 Control Measure 24	CSO 063 Relief/Consolidation Sewer	Bid Year 2013 Achievement of Full Operation 2014	December 31, 2013 December 31, 2014	Design is scheduled to commence in October 2012.

3. Current Reporting Period Consent Decree Submissions (IX. Paragraph 46.c.)

"A summary of the submissions under this Decree that were sent to U.S. EPA and/or Ohio EPA, including the dates submitted".

Table 3: Current Reporting Period Consent Decree Submissions

Reference	Deliverable Description	Milestone in CD	Calendar Milestone	Actual Submittal Date
Control Measure 2	Easterly WWTP Chemically Enhanced High Rate Treatment Work Plan	January 1, 2011	January 1, 2011	December 28, 2010
	Easterly WWTP Chemically Enhanced High Rate Treatment Work Plan – Revised, with written responses to EPA comments	N/A	N/A	April 14, 2011
	Easterly WWTP Chemically Enhanced High Rate Treatment Work Plan – Updated by Addendum	N/A	N/A	August 30, 2011
Control Measure 3	Westerly CSOTF Chemically Enhanced High Rate Treatment Work Plan	January 1, 2011	January 1, 2011	December 28, 2010
	Westerly CSOTF Chemically Enhanced High Rate Treatment Work Plan – Revised, with written responses to EPA comments	N/A	N/A	April 14, 2011
	Westerly CSOTF Chemically Enhanced High Rate Treatment Work Plan – Updated by Addendum	N/A	N/A	August 30, 2011

Table 3: Current Reporting Period Consent Decree Submissions

Reference	Deliverable Description	Milestone in CD	Calendar Milestone	Actual Submittal Date
Control Measure 4	Southerly WWTC Chemically Enhanced High Rate Treatment Work Plan	January 1, 2011	January 1, 2011	December 28, 2010
	Southerly WWTC Chemically Enhanced High Rate Treatment Work Plan – Revised, with written responses to EPA comments	N/A	N/A	April 14, 2011
	Southerly WWTC Chemically Enhanced High Rate Treatment Work Plan – Updated by Addendum	N/A	N/A	August 30, 2011
Consent Decree Paragraph 19/	Green Infrastructure (GI) Plan	December 31, 2011	December 31, 2011	December 28, 2011
Appendix 3	Green Infrastructure (GI) Plan – Revised, with written response to EPA comments	N/A	N/A	March 1, 2012
	Green Infrastructure (GI) Plan - Updated as requested by EPA approval letter	N/A	N/A	April 25, 2012

4. Certification Statement (IX. Paragraph 48)

certify under penalty of law that this document and all attachments were prepared under my
lirection or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the
person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false
nformation, including the possibility of a fine and imprisonment for knowing violations.

Julius Ciaccia, Executive Director	Date

Appendix:


Current CSO and Bypass Reports Submitted to OEPA

(IX. Paragraph 46.d.)

"NEORSD shall also submit, with each Semi-Annual Status report, copies (to EPA only) of all monthly monitoring reports, noncompliance reports, and other reports pertaining to CSO discharges and bypasses that NEORSD submitted to or is required to submit to Ohio EPA in the preceding six months."

Appendix

Current CSO and Bypass Reports Submitted to OEPA

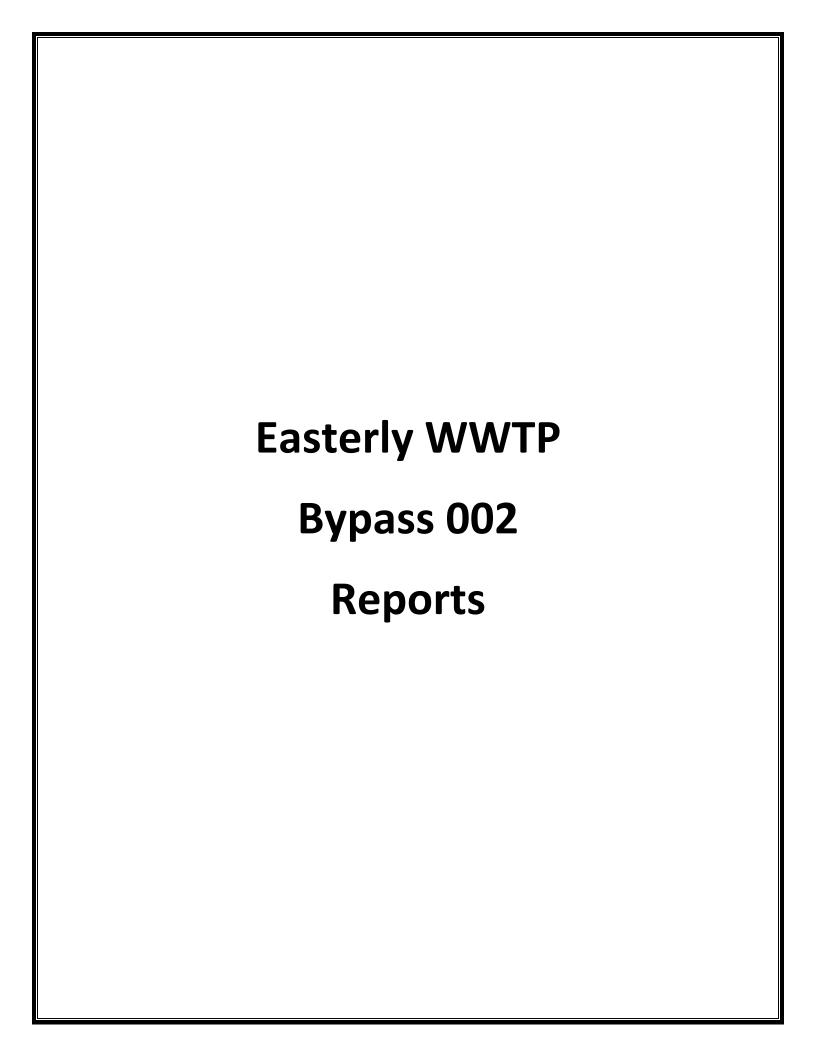



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	September 10, 2011 (8:15 AM – 10:04 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	4.5 MG	
Characteristics of discharge:	Screened Sewage at Station Number 3PF00001002	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge	е	
Describe the circumstances that		
created the discharge:		
Contact person with knowledge of discha		
Name:	Kevin Arth, Eric Taylor	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	September 26, 2011 (6:13 PM – 8:24 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	8.7 MG	
Characteristics of discharge:	Screened Sewage at Station Number 3PF00001002	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather, hydrological event	
created the discharge:	1	
Contact person with knowledge of discharge (if different than above)		
Name:	Eric Taylor, James Cahill	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	October 19, 2011 (6:19 PM – 8:57 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	7.19 MG	
Characteristics of discharge:	Screened Sewage at Station Number 3PF00001002	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that created the discharge:	Wet Weather, hydrological event	
Contact person with knowledge of discharge (if different than above)		
Name:	Kevin Arth, Rawley Ross	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
ischarge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	




Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	December 5, 2011 (8:00 PM – 9:15 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	0.98 MG	
Characteristics of discharge:	Screened Sewage at Station Number 3PF00001002	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet Weather	
created the discharge:		
Contact person with knowledge of discharge (if different than above)		
Name:	Kevin Arth	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	

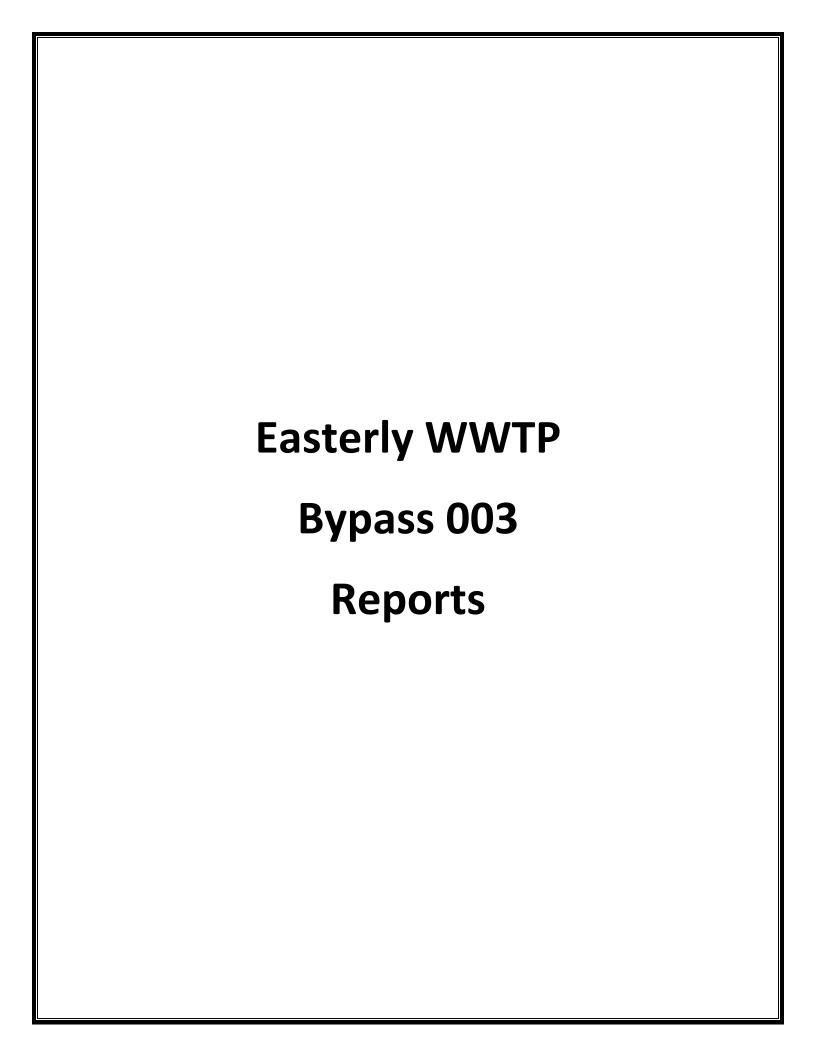



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	July 19, 2011 (3:27 AM – 6:43 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	13 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Eric Taylor	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	July 22, 2011 (5:28 PM – 8:58 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	12.6 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	John Bronowski and Rawley Ross	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	July 23, 2011 (2:24AM – 6:34AM) (11:20PM – 12:00AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	18.2 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discharge (if different than above)		
Name:	Rawley Ross	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	July 24, 2011 (12:00AM – 12:22AM	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	0.7 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Rawley Ross	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	July 28, 2011 (4:42 AM – 12:06 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	31.1 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Rawley Ross	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	August 3 rd 2011 (1:17am - 6:34am)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	19.40 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	John Bronowski
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	August 9, 2011 (10:29 PM – 12:00 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	7.8 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Eric Taylor	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	August 10,2011 (12:00AM – 12:42AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	1.1 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Eric Taylor	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	August 14, 2011 (5:08 PM – 12:00 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	28.4 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Eric Taylor	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	August 15, 2011 (12:00 AM – 3:46 AM) (5:42 AM – 1:08 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	42.2 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Eric Taylor or John Bronowski
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing rem	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	August 21, 2011 (2:00 AM – 3:18 AM) (1:20 PM – 5:14 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	20.0 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	110111001101
Contact person with knowledge of discha	
Name:	Rawley Ross or Jim Cahill
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	August 24, 2011 (8:06 AM – (9:21 AM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	3.6
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Kevin Arth
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	August 25, 2011 (1:41 AM – 8:44 AM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	28.4 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Rawley Ross and Jim Cahill
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	September 4, 2011 (9:34 PM – 12:00 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	11.4 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Kevin Arth	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	September 5, 2011 (12:00 AM) - (5:18 AM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	26.6 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Kevin Arth
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	September 7, 2011 (5:15AM – 5:50AM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	2.3 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Eric Taylor, Jim Cahill
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	September 8, 2011 (7:18 pm – 8:34 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	2.5 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Kevin Arth	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	September 10, 2011 (6:28 AM – 5:22 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	56.1 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	Lake Elle
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Kevin Arth, Eric Taylor
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	September 15, 2011 (2:31 AM – 4:46 AM) (7:16 AM – 3:05 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	32.4 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Kevin Arth, John Bronowski
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	September 19, 2011 (8:40 PM – 10:05 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	5.3 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	John Bronowski	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	September 26, 2011 (4:46 PM – 11:33 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	26.4 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Eric Taylor , Jim Cahill
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	9/29/2011 (10:50PM- 12AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	4.8 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	John Bronowski	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	9/30/11 (12:00 AM – 12:29 AM) (3:06 PM – 12:00 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	49.0 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
	Contact person with knowledge of discharge (if different than above)	
Name:	John Bronowski, James Cahill, Kevin Arth	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	October 1, 2011 (12:00 AM – 4:55 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	84 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Kevin Arth, Rawley Ross	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	October 2, 2011 (6:13 PM – 8:38 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	2.42 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Rawley Ross , James Cahill
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	October 3, 2011 (9:12 AM – 2:19 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	15.2 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	Lake Elle
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Rawley Ross, Eric Taylor
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	October 13, 2011 (9:40 PM – 12:00 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	9.4 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:	Lake Elle	
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Eric Taylor	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	October 14, 2011 (12:00 AM – 3:12 AM) (4:44 AM – 8:05 AM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	18.7 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Eric Taylor, John Bronowski
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	October 19, 2011 (4:22 PM – 12:00 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	39.7 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Kevin Arth and Rawley Ross	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing rem		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us swdo24hournpdes@epa.state.oh.us nwdo24hournpdes@epa.state.oh.us nwdo24hournpdes@epa.state.oh.us nedo24hournpdes@epa.state.oh.us cdo24hournpdes@epa.state.oh.us cdo24hournpdes@epa.state.oh.us co24hournpdes@epa.state.oh.us co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	October 20, 2011 (12: 00 AM – 4:39 AM) (10:22 PM – 12:00 AM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	29.7 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Rawley Ross
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	October 21,2011 (12:00AM – 5:13PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	87 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Rawley Ross, Jim Cahill, John Bronowski	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	10/27/2011 (12:08am-3:20am, 12:46pm-8:06pm)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	40 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	John Bronowski, Eric Taylor	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	11/14/2011 (10:08pm-12:00am)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	7.7 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:	Lake Elle	
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	John Bronowski	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	11/15/2011 (12:00am – 2:26am)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	5.0 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	John Bronowski	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	November 22, 2011 (4:26 PM to 11:36 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	31.8 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Rawley Ross, Jim Cahill	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	November 23, 2011 (5:37AM – 10:09AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	19.4 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Jim Cahill Rawley Ross	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	November 27, 2011 (8:00 PM – 12:00 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	17.0 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Jim Cahill	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	November 28,2011 (12:00 AM – 3:54 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	14.2 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discharge (if different than above)		
Name:	Jim Cahill, Eric Taylor	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us swdo24hournpdes@epa.state.oh.us nwdo24hournpdes@epa.state.oh.us nwdo24hournpdes@epa.state.oh.us nedo24hournpdes@epa.state.oh.us cdo24hournpdes@epa.state.oh.us cdo24hournpdes@epa.state.oh.us co24hournpdes@epa.state.oh.us co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	November 29, 2011 (2:34 AM – 6:05 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	60.1 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:	Lake Elle	
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Rawley Ross, Eric Taylor	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	December 5, 2011 (6:58AM – 12:00 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	70.9 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Kevin Arth	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	December 6, 2011 (12:00 AM – 07:30 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	28.4 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Kevin Arth	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	December 15, 2011 (5:25 AM – 6:49 AM) (3:46 PM – 4:32 PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	4.5 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Kevin Arth	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	12/21/2011 (5:51am – 8:14pm)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	52.5 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	John Bronowski, Kevin Arth, Rawley Ross	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	12/22/2011 (10:24pm – 11:58pm)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	6.1 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	John Bronowski	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: cdo24hournpdes@epa.state.oh.us
Central Office: cdo24hournpdes@epa.state.oh.us
co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	December 30, 2011 (9:04 PM – 12:00 AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	9.7 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Eric Taylor	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	December 31, 2011 (00:00 – 00:21)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	0.4 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Eric Taylor
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	January 11, 2012 (8:26 PM – 10:40 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	4.5 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Kevin Arth
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing rem	·
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	January 17, 2012 (9:15AM – 3:06PM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	21.70 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Rawley Ross , Jim Cahill	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	January 23, 2012 (7:12 AM – 2:01 PM) (4:58 PM – 7:04 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	26 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Kevin Arth, Eric Taylor
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing rem	·
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	January 26, 2012 (10:42PM – 12:00AM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	6.2 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Rawley Ross
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing rem	·
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	January 27, 2012 (12:00AM – 5:38 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	58.1 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Rawley Ross, Kevin Arth, Jim Cahill
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	February 24, 2012 (12:07 AM – 3:55 AM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	13.7 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Rawley Ross, Eric Taylor
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	February 29,2012 (7:54 AM – 2:29 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	34.2 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Rawley Ross , Jim Cahill
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	March 2, 2012 (8:04 PM – 9:55 PM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	4.4 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Kevin Arth
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	March 13, 2012 (5:00 AM – 7:29 AM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	6.8 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	Kevin Arth
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing remedial steps	
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant
NPDES Permit number:	3PF00001*KD
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent
Contact telephone number:	(216) 531-4892
Date and time of discharge	
Date and time(s) of discharge:	March 16, 2012 (3:08AM – 6:20AM)
Date and time discharge discovered:	Same as above
Description of discharge	
Approximate amount of discharge:	11.2 MG
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003
Stream(s) affected by discharge	
Provide the name of all streams	Lake Erie
affected by the discharge:	Lake Lile
Circumstances that created the discharge	
Describe the circumstances that	Wet weather
created the discharge:	
Contact person with knowledge of discha	
Name:	John Bronowski and Rawley Ross
Telephone number:	(216) 531-4892
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	None at this time
discharge:	
Person responsible for implementing rem	·
Name:	N/A
Telephone number:	N/A



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Foots J. Woods, and Treatment Disast	
Easterly Wastewater Treatment Plant	
3PF00001*KD	
Robert M. Bonnett, Plant Superintendent	
(216) 531-4892	
March 18, 2012 (8:00PM – 12:00AM)	
Same as above	
14.0 MG	
Settled Sewage at Station Number 3PF00001003	
Lake Erie	
Lane Lile	
Circumstances that created the discharge	
Wet weather	
WEL WEALIE	
(if different than above)	
Rawley Ross	
(216) 531-4892	
Telephone number: (216) 531-4892 Remedial steps	
None at this time	
Person responsible for implementing remedial steps	
N/A	
N/A	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	Permittee Information	
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	March 19, 2012 (12:00AM – 2:02AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	7.1 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:		
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:		
Contact person with knowledge of discha		
Name:	Rawley Ross, Eric Taylor	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	




Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Downsitte a Information		
Permittee Information		
Name of permittee:	Easterly Wastewater Treatment Plant	
NPDES Permit number:	3PF00001*KD	
Contact name for permittee:	Robert M. Bonnett, Plant Superintendent	
Contact telephone number:	(216) 531-4892	
Date and time of discharge		
Date and time(s) of discharge:	May 8, 2012 (7:57AM – 11:51AM)	
Date and time discharge discovered:	Same as above	
Description of discharge		
Approximate amount of discharge:	13.1 MG	
Characteristics of discharge:	Settled Sewage at Station Number 3PF00001003	
Stream(s) affected by discharge		
Provide the name of all streams	Lake Erie	
affected by the discharge:	Lake Cile	
Circumstances that created the discharge		
Describe the circumstances that	Wet weather	
created the discharge:	vvet weather	
Contact person with knowledge of discharge (if different than above)		
Name:	Kevin Arth, John Bronowski	
Telephone number:	(216) 531-4892	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the	None at this time	
discharge:		
Person responsible for implementing remedial steps		
Name:	N/A	
Telephone number:	N/A	

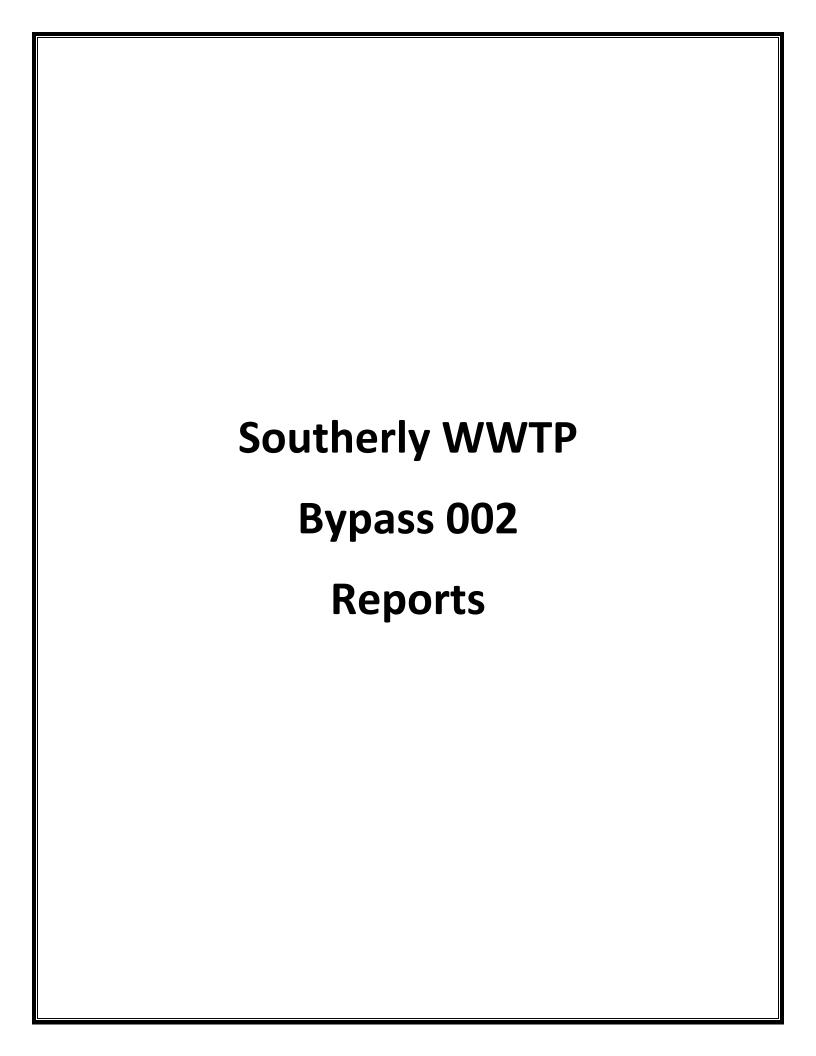



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	John Augustine
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	0317 to 1255 hrs on July 19, 2011
Date and time discharge discovered:	0317 hrs on July 19, 2011
Description of discharge	
Approximate amount of discharge:	95.17 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Ray Blewitt
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information		
Name of permittee:	NEORSD- Southerly WWTP	
NPDES Permit number:	3PF00002*LD	
Contact name for permittee:	John Augustine	
Contact telephone number:	216-641-3200	
Date and time of discharge		
Date and time(s) of discharge:	1958 hrs. to 2400 hrs on July 23, 2011	
Date and time discharge discovered:	1958 hrs on July 23, 2011	
Description of discharge		
Approximate amount of discharge:	23.22 MG	
Characteristics of discharge:	Settled sewage	
Stream(s) affected by discharge		
Provide the name of all streams	Cuyahoga River	
affected by the discharge:		
Circumstances that created the discharge	Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity	
created the discharge:		
Contact person with knowledge of discha	arge (if different than above)	
Name:	Ray Blewitt	
Telephone number:	216-641-3200	
Remedial steps		
Describe all remedial steps which are		
or will be taken to address the		
discharge:		
Person responsible for implementing rem	nedial steps	
Name:		
Telephone number:		



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	John Augustine
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	0000 hrs. to 0051 hrs. on July 24, 2011
Date and time discharge discovered:	0000 hrs July 24, 2011
Description of discharge	
Approximate amount of discharge:	3.78 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharg	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Ray Blewitt
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing rem	nedial steps
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	John Augustine
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	8/14/2011 1545- 0000
Date and time discharge discovered:	1545
Description of discharge	
Approximate amount of discharge:	77.53 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharg	e
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	arge (if different than above)
Name:	
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing rem	nedial steps
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	John Augustine
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	0000 hrs. to 1551 hrs. on August 15, 2011
Date and time discharge discovered:	0000 hrs August 15, 2011
Description of discharge	
Approximate amount of discharge:	134.51 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharg	e
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Ray Blewitt
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	John Augustine
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	9/10/2011 11:35 hr to 14:25 hr
Date and time discharge discovered:	9/10/2011 11:35 hr
Description of discharge	
Approximate amount of discharge:	7.11 million gallons
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Mary Garapic
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	1651 to 2320 on September 26,2011
Date and time discharge discovered:	1651 on September 20,2011
Description of discharge	
Approximate amount of discharge:	39.38 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Renato Contipelli
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	John Augustine
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	100111 0227-1934 hrs
Date and time discharge discovered:	0227 hrs
Description of discharge	
Approximate amount of discharge:	113.37 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Charles Boyd
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	1623-2400 hrs. on October 19 th , 2011
Date and time discharge discovered:	1623 hrs on October 19 th , 2011
Description of discharge	
Approximate amount of discharge:	97.12 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	e
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Ray Blewitt
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	0000 to 1250 on October 20, 2011
Date and time discharge discovered:	0000 on October 20, 2011
Description of discharge	
Approximate amount of discharge:	75.06 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	e
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Keith Manning
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP 11-14-2011-Bypass - 002
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	11-14-2011 21:40
Date and time discharge discovered:	11-14-2011 21:40
Description of discharge	
Approximate amount of discharge:	9.42 Million Gallons
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Mary Garapic
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	11/15/2011 00:00 hr to 01:45 hr
Date and time discharge discovered:	11/15/2011 00:00 hr
Description of discharge	
Approximate amount of discharge:	4.55 million gallons
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharg	e
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Mary Garapic
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	11/29/11 04:47-17:19 hours
Date and time discharge discovered:	11/29/11 04:47 hours
Description of discharge	
Approximate amount of discharge:	66.60 million gallons
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	arge (if different than above)
Name:	Michael Mencl
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	12/5/2011 1506-2400 hrs
Date and time discharge discovered:	1506 hrs
Description of discharge	
Approximate amount of discharge:	84.29 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Charles Boyd
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	2400-1139 hrs. on December 6 th , 2011
Date and time discharge discovered:	2400 hrs. on December 6th
Description of discharge	
Approximate amount of discharge:	78.51 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharg	e
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Ray Blewitt
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	12-21-2011 10:00 - 1806
Date and time discharge discovered:	12-21-2011 10:00
Description of discharge	
Approximate amount of discharge:	30.25 Million Gallons
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Charles Boyd
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Dannaitta a Infansa atian	
Permittee Information	NEODOD O (L. L. MINISTER
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	1020-1340 hrs. on January 17 th , 2012
Date and time discharge discovered:	1020 hrs on January 17 th , 2012
Description of discharge	
Approximate amount of discharge:	8.72 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharg	e
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	arge (if different than above)
Name:	Ray Blewitt
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD – Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	0027 – 1013 hrs. on January 27 th , 2012
Date and time discharge discovered:	0027 hrs. on January 27 th , 2012
Description of discharge	
Approximate amount of discharge:	55.28 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	arge (if different than above)
Name:	Brian Vaccher
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD – Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	February 29, 2012 10:19 am / 2 :36pm
Date and time discharge discovered:	10:19am
Description of discharge	
Approximate amount of discharge:	15.99
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Brian Vaccher
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

NEODOD O. (L. J. MANATO	
NEORSD- Southerly WWTP	
3PF00002*LD	
George Schur	
216-641-3200	
2232 hrs-2400 hrs on March 18 th , 2012	
2232 hrs on March 18 th 2012	
Date and time discharge discovered: 2232 hrs on March 18 th 2012 Description of discharge	
9.81 MG	
Settled sewage	
Cuyahoga River	
affected by the discharge: Circumstances that created the discharge	
Exceeded the plant's hydraulic capacity	
arge (if different than above)	
Ray Blewitt	
216-641-3200	
Person responsible for implementing remedial steps	



Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	0000 hrs 0132 hrs. on March 19 th , 2012
Date and time discharge discovered:	0000 hrs. on March 19 th , 2012
Description of discharge	
Approximate amount of discharge:	6.37 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Exceeded the plant's hydraulic capacity
created the discharge:	
Contact person with knowledge of discha	
Name:	Brian Vaccher
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	



Division of Surface Water


Non-compliance Notification for Bypasses and Upsets

Use this form to report non-compliance that is the result of any **unanticipated bypass** or **upset** resulting in an exceedance of any **effluent limit** in your NPDES permit (see Part III, Section 12 of your NPDES permit for details). The form should be completed and emailed to the appropriate Ohio EPA inspector, or Ohio EPA office using one of the following addresses:

Southeast District Office: sedo24hournpdes@epa.state.oh.us
Southwest District Office: swdo24hournpdes@epa.state.oh.us
Northwest District Office: nwdo24hournpdes@epa.state.oh.us
Northeast District Office: nedo24hournpdes@epa.state.oh.us
Central District Office: co24hournpdes@epa.state.oh.us
Central Office: co24hournpdes@epa.state.oh.us

On a case-by-case basis it may be determined an environmental emergency exists. Report environmental emergencies within thirty (30) minutes of discovery to Ohio EPA 24-hours a day, 365 days a year at 800-282-9378!

Permittee Information	
Name of permittee:	NEORSD- Southerly WWTP
NPDES Permit number:	3PF00002*LD
Contact name for permittee:	George Schur
Contact telephone number:	216-641-3200
Date and time of discharge	
Date and time(s) of discharge:	0821 hrs 0826 hrs. on March 19 th , 2012
Date and time discharge discovered:	0821 hrs. on March 19 th , 2012
Description of discharge	
Approximate amount of discharge:	0.60 MG
Characteristics of discharge:	Settled sewage
Stream(s) affected by discharge	
Provide the name of all streams	Cuyahoga River
affected by the discharge:	
Circumstances that created the discharge	
Describe the circumstances that	Plant Power Outage
created the discharge:	
Contact person with knowledge of discharge (if different than above)	
Name:	Raymond Blewitt
Telephone number:	216-641-3200
Remedial steps	
Describe all remedial steps which are	
or will be taken to address the	
discharge:	
Person responsible for implementing remedial steps	
Name:	
Telephone number:	

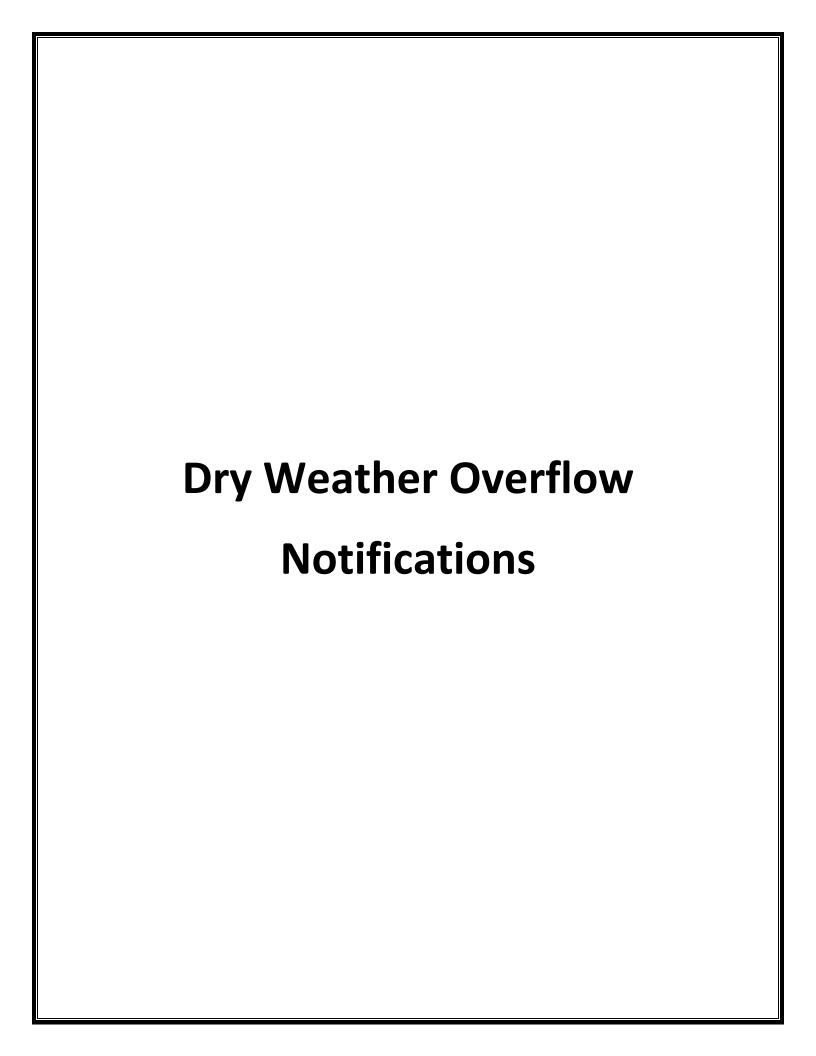



To: Erm Gomes **From:** Charles Cofield

Ohio EPA **Date:** 7/20/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CRR-5) Albers at Rocky River Dr. **CSO:**068

Date Found: 7/20/2011 **Time:** 2:25 pm

Receiving Water: Rocky River

Approximate Discharge (CFS): 0.07 CFS

Cause: Unknown Materials

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 7/20/2011

Duration of Discharge (Hrs.): 1.25 HRS.

Corrective Action: Flushed debris from leaper

Work Order#: 1115589



To: Erm Gomes From: Charles Cofield

Ohio EPA

Date: 7/26/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CD-14) E.106th & St.Clair Avenue **CSO:**230

Date Found: 7/26/2011 **Time:** 1:00 PM

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.28 CFS

Cause: Walking cane, sticks and massive debris build-up in pipe

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 7/26/2011

Duration of Discharge (Hrs.): 5.00 HRS.

Corrective Action: Jet Rodded, Vacuumed & Tech entry to dislodge blockage at perp

Work Order#: 1116238



To: Erm Gomes **From:** Wilson Rivera

Ohio EPA

Date: 7/29/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: W. 14th St. Just north of Mentor **CSO:**087

Date Found: 7/29/2011 **Time:** 9:50 am

Receiving Water: Cuyahoga River

Approximate Discharge (CFS): 0.39 CFS

Cause: Grease and debris.

Proposed Remedial Action: Jet and Vac.

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 7/29/2011

Duration of Discharge (Hrs.): 1.00 HRS.

Corrective Action: Jet and Vac line, removed debris.

Work Order#: 1116429



To: Erm Gomes From: George Uhl Ohio EPA

Date: 8/11/2011

Revised Copy
Dry Weather Discharge Advisory

∑ Initial Advisory

☐ Five-Day Status Report

Discharge Location: (WR-6) W. 3rd at Mary Ave. **CSO:** 086

Date Found: 8/9/2011 **Time:** 8:05AM

Receiving Water: Cuyahoga River

Approximate Discharge (CFS): 0.41 CFS

Description of Problem: City of Cleveland, Mary Street Pump Station, both pumps

down.

Community with Maintenance Responsibility: City of Cleveland (Water Pollution

Control)

Contact Person: Cecilia Mazzei

Additional Information: Cecilia Mazzei contacted NEORSD at 8:05 AM on 8/9/2011

stating that the station went down at 10:48PM on Sunday, August 7, 2011. The city is waiting on parts to make the needed repairs to get the pump station back on-line.

Date Corrected:

Duration of Discharge:

Work Order#: 1116427

NOTE: This is not a dry weather overflow caused by a malfunctioning combined sewer overflow regulator. This discharge, however, is considered an upset pursuant to 40 CFR Part 122.41(n)



To: Erm Gomes From: Wilson Rivera Ohio EPA

Date: 8/17/2011

Revised Copv **Dry Weather Discharge Advisory**

Initial Advisory

Five-Day Status Report

(WR-6) W. 3rd at Mary Ave. **Discharge Location: CSO**: 086

Date Found: 8/9/2011 **Time:** 8:05AM

Cuyahoga River **Receiving Water:**

Approximate Discharge (CFS): 0.41 CFS

Description of Problem: City of Cleveland, Mary Street Pump Station, both pumps

down.

Community with Maintenance Responsibility: City of Cleveland (Water Pollution

Control)

Contact Person: Cecilia Mazzei

Additional Information: The City of Cleveland is attempting to overpump the

> collection system feeding into the pump station. A temporary bypass pump is in place and running 24 hours-per-day. As of 8:30AM on 8/17/2011 there is still approximatly 2-inch of dry weather flow going over the weir wall at regulator WR-6. The station went out-of service at 10:48PM on 8/7/2011.

Date Corrected:

Duration of Discharge:

Work Order#: 1116427

NOTE: This is not a dry weather overflow caused by a malfunctioning combined sewer overflow regulator. This discharge, however, is considered an upset pursuant to 40 CFR Part 122.41(n)

The Northeast Ohio Regional Sewer District's mission is to serve our customers by leading



To: Erm Gomes From: George Uhl Ohio EPA

Date: 8/17/2011

Dry Weather Discharge Advisory

☐ Initial Advisory

Five-Day Status Report

Discharge Location: (WR-6) W. 3rd at Mary Ave. **CSO:** 086

Date Found: 8/9/2011 **Time:** 8:05AM

Receiving Water: Cuyahoga River

Approximate Discharge (CFS): 0.41 CFS

Description of Problem: City of Cleveland, Mary Street Pump Station, both pumps

down.

Community with Maintenance Responsibility: City of Cleveland (Water Pollution

Control)

Contact Person: Cecilia Mazzei

Additional Information: The City of Cleveland is attempting to overpump the

collection system feeding into the pump station. A pump is in

place and running 24 hours-per-day. As of 8:30AM on 8/17/2011 there is still approximatly 2-inch of dry weather flow going over the weir wall at regulator WR-6. The station went out-of service at 10:48PM on 8/7/2011. NEORSD will be installing a larger temporary pumping system today.

Date Corrected:

Duration of Discharge:

Work Order#: 1116427

NOTE: This is not a dry weather overflow caused by a malfunctioning combined sewer overflow regulator. This discharge, however, is considered an upset pursuant to 40 CFR Part 122.41(n)



To: Erm Gomes From: George Uhl Ohio EPA

Date: 8/24/2011

Dry Weather Discharge Advisory

Initial Advisory

☐ Five-Day Status Report

Discharge Location: (WR-6) W. 3rd at Mary Ave. **CSO:** 086

Date Found: 8/9/2011 **Time:** 8:05AM

Receiving Water: Cuyahoga River

Approximate Discharge (CFS): 0.41 CFS

Description of Problem: City of Cleveland, Mary Street Pump Station, both pumps

down.

Community with Maintenance Responsibility: City of Cleveland (Water Pollution

Control)

Contact Person: Cecilia Mazzei

Additional Information: The station went out-of service at 10:48PM on 8/7/2011.

NEORSD set up Godwin Pumps and started temporary pump station pumping on 8/19/2011. The dry weather overflow

stopped at 4:05PM on 8/19/2011.

Date Corrected: 8/19/2011

Duration of Discharge: 281.30 HRS.

Work Order#: 1116427

NOTE: This is not a dry weather overflow caused by a malfunctioning combined sewer overflow regulator. This discharge, however, is considered an upset pursuant to 40 CFR Part 122.41(n)



To: Erm Gomes From: Charles Cofield

Ohio EPA **Date:** 8/10/2011

Dry Weather Discharge Advisory

☐ Initial Advisory

☐ Five-Day Status Report

Discharge Location: (CWR-2)W.3RD @ Service Court by P. Station **CSO:** 089

Date Found: 8/9/2011 **Time:** 9:30AM

Receiving Water: Cuyahoga River

Approximate Discharge (CFS): 0.10 CFS

Description of Problem: City of Cleveland's (WPC), pump station down

Community with Maintenance Responsibility: City of Cleveland

Contact Person: Cecilia Mazzei, P.E.

Additional Information: Pump Station has (2) dysfunctional pumps

Date Corrected: Repairs still in progress by City of Cleveland

Duration of Discharge: 24.00 Hrs.

Work Order#: 1116427

NOTE: This is not a dry weather overflow caused by a malfunctioning combined sewer overflow regulator. This discharge, however, is considered an upset pursuant to 40 CFR Part 122.41(n)



To: Erm Gomes From: Charles Cofield

Ohio EPA

Date: 8/15/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CWR-37) W.56TH South of Denison Ave. **CSO:**085

Date Found: 8/12/2011 **Time:** 10:30 AM

Receiving Water: Big Creek

Approximate Discharge (CFS): 0.07 CFS

Cause: Miscellaneous Debris

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 8/12/2011

Duration of Discharge (Hrs.): 0.50 HRS.

Corrective Action: Vacuumed debris from leaper opening

Work Order#: 1117733



To: Erm Gomes **From:** Wilson Rivera

Ohio EPA

Date: 8/17/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: Superior Ave. at E. 123rd st. & Lakeview **CSO:**230

Date Found: 8/13/2011 **Time:** 10:00AM

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.43 CFS

Cause: Sand, grit and debris entered the system, via a water main break located

adjacent to the regulator.

Proposed Remedial Action: Jet and Vac

Jurisdiction: NEORSD

Contact Person: Wilson Rivera

Additional Information: Contractor and or Municipality damaged NEORSD pipe.

Date Corrected: 8/13/2011

Duration of Discharge (Hrs.): 4.50 HRS.

Corrective Action: Jet and Vac line. Removed material from pipe.

Work Order#: 1117736



4747 East 49th Street

Phone: 216-641-6000 Fax: 216-641-5124

To: Erm Gomes **From:** George Uhl

Ohio EPA

Date: 8-25-2011

Northeast Ohio Regional Sewer District Wet Weather Overflow Notification

☐ Initial Advisory

▼ Five-Day Status Report

Structure: Mill Creek Tunnel Overflow at shaft #3 (Silo) to Mill Creek CSO: N/A

in Harvard Landfill

Date Found: 8/15/11 **Time:**8:30

Receiving Water: Mill Creek

Approximate Discharge (CFS): (Average) 50.9 CFS

Cause: Controlling gates on the Mill Creek Tunnel were closed by Southerly

personnel to protect Southerly WWTP.

Proposed Remedial Action: When rain subsided; Southerly WWTP opened the

controlling gates.

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 8/15/11

Duration of Discharge (Hrs.): 2.3 Hrs.

Corrective Action:

Work Order#:



Ohio EPA

4747 East 49th Street Phone: 216-641-6000 Fax: 216-641-5120

To: Erm Gomes **From:** Richard Pietruszka

Date: 8/16/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

\bowtie	Initial Advisory
	Five-Day Status Report

Structure: H-14 Coit S. of Woodworth CSO:211

Date Found: 8/16/2011 **Time:** 1:25 pm

Receiving Water: Nine Mile Creek

Approximate Discharge (CFS): 0.02 CFS

Cause: Grit build up and increased flow from local lines.

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: Increase of flow (clean water) entering the system via

upstream sewer lines. WQIS investigated and could not determine where additional flow was entering the system.

Date Corrected: 8/16/2011

Duration of Discharge (Hrs.): 3.08 HRS.

Corrective Action: Jet/Vac

Work Order#: 1118040



To: Erm Gomes **From:** George Uhl

Ohio EPA

Date: 8/23/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☒ Five-Day Status Report

Structure: Doan Valley Interceptor down-stream of Regulator **CSO:**224

DV-01 (Stokes Blvd. at Baldwin Road) in Rudy Rodgers

Park

Date Found: 8/17/2011 **Time:** 2:30PM

Receiving Water: Doan Brook

Approximate Discharge (CFS): 0.14 CFS

Cause: Bucket blocking 12-inch Interceptor

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: A root cutting attachment was used on the Vactor to cut up

and remove the blockage (bucket) that was blocking the

Interceptor

Date Corrected: 8/19/2011

Duration of Discharge (Hrs.): 48.00 HRS.

Corrective Action: Vactor with root cutting attachment removed blockage (bucket).

Work Order#: 1118124



To: Erm Gomes **From:** Charles Cofield

Ohio EPA

Date: 9/2/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CE-50A) E.55th Street, North of St. Clair Avenue **CSO:**202

Date Found: 9/1/2011 **Time:** 12:30 PM

Receiving Water: Lake Erie

Approximate Discharge (CFS): 0.3608 CFS

Cause: Plastic bottles and other debris

Proposed Remedial Action: Jet and Vacuum

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 9/1/2011

Duration of Discharge (Hrs.): 2.00 HRS.

Corrective Action: Tech descended to leaper and removed blockage with pike pole

Work Order#: 1119382



To: Erm Gomes From: George Uhl Ohio EPA

Date: 9/16/2011

Dry Weather Discharge Advisory

☐ Initial Advisory

Five-Day Status Report

Discharge Location: (E-44) E. 93rd and Ansel Road **CSO:** 219

Date Found: 9/14/2010 **Time:** 11:05AM

Receiving Water: Doan Brook

Approximate Discharge (CFS): 0.22 CFS

Description of Problem: Contractor repaving street dumped concrete/debris into

manhole down-stream of regulator backing up sewer causing

overflow

Community with Maintenance Responsibility: NEORSD

Contact Person: Brian Stapleton

Additional Information: Crew had to break up dumped concrete/debris and remove it

from the pipe, restablishing flow eliminating back-up.

Date Corrected: 9/14/2011

Duration of Discharge: 7.0 HRS.

Work Order#: 1120360

NOTE: This is not a dry weather overflow caused by a malfunctioning combined sewer overflow regulator. This discharge, however, is considered an upset pursuant to 40 CFR Part 122.41(n)



To: Erm Gomes From: George Uhl Ohio EPA

Date: 9/16/2011

Revised Copy
Dry Weather Discharge Advisory

☐ Initial Advisory

⊠ Five-Day Status Report

Discharge Location: (E-44) E. 93rd and Ansel Road **CSO:** 219

Date Found: 9/14/2010 **Time:** 11:05AM

Receiving Water: Doan Brook

Approximate Discharge (CFS): 0.22 CFS

Description of Problem: Contractor repaying street dumped concrete/debris into

manhole down-stream of regulator backing up sewer causing

overflow.

Community with Maintenance Responsibility: City Of Cleveland (Khalil Ewais)

216-664-7422

Contact Person: Wayne Martin (Fabrizi) 216-440-1534 Dan Montero (Perk Comp).

Additional Information: Crew had to break up dumped concrete/debris and remove it

from the pipe, restablishing flow eliminating back-up.

Date Corrected: 9/14/2011

Duration of Discharge: 7.0 HRS.

Work Order#: 1120360

NOTE: This is not a dry weather overflow caused by a malfunctioning combined sewer overflow regulator. This discharge, however, is considered an upset pursuant to 40 CFR Part 122.41(n)



To: Erm Gomes **From:** Charles Cofield

Ohio EPA

Date: 9/28/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CD-35) Tuscora Avenue & Linn Drive CSO:230

Date Found: 9/27/2011 **Time:** 11:05 a.m.

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.36 CFS

Cause: Unknown Blockage

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 9/27/2011

Duration of Discharge (Hrs.): 0.90 HRS.

Corrective Action: Jetted sewer 50 to 60 feet downstream to remove blockage

Work Order#: 1118123



To: Erm Gomes From: George Uhl Ohio EPA

Date: 10/10/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (BC-29) 4142 West 36th Street near Krather Ave. **CSO:**050

Date Found: 10/5/2011 **Time:** 9:00AM

Receiving Water: Big Creek

Approximate Discharge (CFS): 0.32 CFS

Cause: Debris and grit.

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 10/5/2011

Duration of Discharge (Hrs.): 1.50 HRS.

Corrective Action: Jet and vac line.

Work Order#: 1121506



To: Erm Gomes From: Charles Cofield

Ohio EPA

Date: 10/7/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CD-32) Berkshire Avenue & Linn Drive CSO:230

Date Found: 10/6/2011 **Time:** 12:25 p.m.

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.25 CFS

Cause: Unknown Blockage

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 10/6/2011

Duration of Discharge (Hrs.): 0.50 HRS.

Corrective Action: Jet Rodded 35 feet downstream to remove blockage

Work Order#: 1120578



To: Erm Gomes **From:** Charles Cofield

Ohio EPA

Date: 10/7/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CD-35) Tuscora Avenue & Linn Drive CSO:230

Date Found: 10/6/2011 **Time:** 12:55 p.m.

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.36 CFS

Cause: Rags & Debris

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 10/6/2011

Duration of Discharge (Hrs.): 0.40 HRS.

Corrective Action: Jet Rodded 30 feet to downstream manhole

Work Order#: 1122299



To: Erm Gomes From: George Uhl Ohio EPA

Date: 10/14/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: D-16, 10662 Helena in driveway CSO:230

Date Found: 10/13/2011 **Time:** 9:50AM

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.43 CFS

Cause: Grease and grit build-up

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 10/13/2011

Duration of Discharge (Hrs.): .50 HRS.

Corrective Action: Jet/Vac

Work Order#: 1122758



To: Erm Gomes From: George Uhl Ohio EPA

Date: 10/14/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: MC-16, Broadway Ave. 115' east of E. 94th Street **CSO:**021

Date Found: 10/13/2011 **Time:** 1:20PM

Receiving Water: Mill Creek

Approximate Discharge (CFS): 0.25 CFS

Cause: Section of plywood was lodged in DWO

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 10/13/2011

Duration of Discharge (Hrs.): 0.90

Corrective Action: Jet/Vac

Work Order#: 1122766



To: Erm Gomes From: George Uhl Ohio EPA

Date: 10/14/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (WR-37) W. 56th Street 800' south of Denison Ave. **CSO:**085

Date Found: 10/13/2011 **Time:** 1:20 PM

Receiving Water: Big Creek

Approximate Discharge (CFS): 0.07 CFS

Cause: Sticks and debris in leaping weir

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 10/13/2011

Duration of Discharge (Hrs.): 1.00

Corrective Action: Removed sticks, Jet and Vac line

Work Order#: 1122765



To: Erm Gomes **From:** Charles Cofield

Ohio EPA

Date: 10/20/2011

Northeast Ohio Regional Sewer District
Dry Weather Overflow Notification
Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☒ Five-Day Status Report

Structure: (CD-32) Berkshire Avenue & Linn Drive CSO:230

Date Found: 10/19/2011 **Time:** 1:05 p.m.

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.25 CFS

Cause: Grease

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 10/19/2011

Duration of Discharge (Hrs.): 0.40 Hrs.

Corrective Action: Jet Rodded 50 feet towards downstream manhole to remove block

Work Order#: 1123128



To: Erm Gomes From: George Uhl Ohio EPA

Date: 10/25/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (H-14) Coit Road south of Woodworth CSO:211

Date Found: 10/24/2011 **Time:** 2:49 pm

Receiving Water: Nine Mile Creek

Approximate Discharge (CFS): 0.20 CFS

Cause: Grit build up down-stream of regulator.

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 10/24/2011

Duration of Discharge (Hrs.): 5.20

Corrective Action: Jet/Vac

Work Order#: 1123224



To: Erm Gomes **From:** George Uhl

Ohio EPA

Date: 10/31/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (BC-36) 4099 West 56th Street north of Ridgeview **CSO:**053

Date Found: 10/28/2011 **Time:** 2:50PM

Receiving Water: Big Creek

Approximate Discharge (CFS): 0.14 CFS

Cause: Debris and grit.

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 10/28/2011

Duration of Discharge (Hrs.): 0.50 HRS.

Corrective Action: Jet and vac line.

Work Order#: 1123909



To: Erm Gomes From: George Uhl Ohio EPA

Date: 10/31/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (WR-37) W. 56th Street 800' south of Denison Ave. **CSO:**085

Date Found: 10/31/2011 **Time:** 1:00 PM

Receiving Water: Big Creek

Approximate Discharge (CFS): 0.07 CFS

Cause: Debris in leaping weir

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 10/31/2011

Duration of Discharge (Hrs.): 0.30 HRS.

Corrective Action: Jet and Vac line

Work Order#: 1123968



To: Erm Gomes

Ohio EPA

From: Charles Cofield

Date: 11/4/2011

Northeast Ohio Regional Sewer District
Dry Weather Overflow Notification
Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☒ Five-Day Status Report

Structure: (CD-10) 557 East 106th St.-Glenville & Clairdoan Ave. CSO:230

Date Found: 11/3/2011

Time:

1:30 pm

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.18 CFS

Cause: Grease & Debris

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: Regulator originally reported as partial block taking flow

with splash-over, but rectified as followed.

Date Corrected: 11/4/2011

Duration of Discharge (Hrs.): 17.50 HRS.

Corrective Action: Jet Rodded 300 feet to downstream regulator to unblock

Work Order#: 1124471



To: Erm Gomes From: Charles Cofield

Ohio EPA

Date: 11/22/2011

Revised Copy

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☒ Five-Day Status Report

Structure: (CD-10) 557 East 106th St.-Glenville & Clairdoan Ave. **CSO:**230

Date Found: 11/3/2011 **Time:** 1:30 pm

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.18 CFS

Cause: Grease & Debris

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: The sanitary sewer was partially blocked 300 feet down-

stream of the regulator.

Date Corrected: 11/4/2011

Duration of Discharge (Hrs.): 19.00 HRS.

Corrective Action: Jet Rodded to 2nd downstream manhole to remove blockage.

Work Order#: 1124471



To: Erm Gomes From: Charles Cofield

Ohio EPA **Date:** 11/15/2011

Dry Weather Discharge Advisory

∑ Initial Advisory

☐ Five-Day Status Report

Discharge Location: (E-44) E. 93rd St. and Ansel Road **CSO:** 219

Date Found: 11/4/2011 **Time:** 3:45 pm

Receiving Water: Doan Brook

Approximate Discharge (CFS): 0.22 CFS

Description of Problem: Contractor repaying street dumped concrete/debris into

manhole down-stream of regulator backing up sewer causing

overflow.

Community with Maintenance Responsibility: City Of Cleveland (Khalil Ewais)

216-664-7422

Contact Person: Wayne Martin (Fabrizi) 216-440-1534 Dan Montero (Perk Comp).

Additional Information: SSMO crews jet rodded three manholes downstream of

regulator, removing debris & relieved overflow conditions.

Date Corrected: 11/4/2011

Duration of Discharge: 8.00 HRS.

Work Order#: 1124702

NOTE: This is not a dry weather overflow caused by a malfunctioning combined sewer overflow regulator. This discharge, however, is considered an upset pursuant to 40 CFR Part 122.41(n)



To: Erm Gomes **From:** Charles Cofield

Ohio EPA

Date: 11/17/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☒ Five-Day Status Report

Structure: (CD-32) Berkshire Ave. & Linn Dr. CSO:230

Date Found: 11/16/2011 **Time:** 12:35 pm

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.25 CFS

Cause: Plastic and floatable debris

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 11/16/2011

Duration of Discharge (Hrs.): 0.40 HRS.

Corrective Action: Jet Rodded 30 feet to downstream manhole to dislodge debris

Work Order#: 1124880



To: Erm Gomes From: Charles Cofield

Ohio EPA

Date: 11/25/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CMC-31) E.173rd Street & South of Elmer Ave. **CSO:**028

Date Found: 11/23/2011 **Time:** 10:32 AM

Receiving Water: Mill Creek

Approximate Discharge (CFS): 0.43 CFS

Cause: Hubcap stuck in outlet pipe

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 11/23/2011

Duration of Discharge (Hrs.): 1.00 HRS.

Corrective Action: Jet Rodded 100' upstream & tech decended pipe to remove hubcap

Work Order#: 1114409



To: Erm Gomes **From:** George Uhl

Ohio EPA

Date: 11/28/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: D-35, Tuscora at Linn Drive CSO:230

Date Found: 11/28/2011 **Time:** 8:55AM

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.36 CFS

Cause: Grease and debris

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 11/28/2011

Duration of Discharge (Hrs.): 2.10 HRS.

Corrective Action: Jet/Vac

Work Order#: 1125757



To: Erm Gomes From: Charles Cofield

Ohio EPA **Date:** 12/2/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CRR-5) Rocky River Dr. @ Albers Ave. **CSO:**068

Date Found: 12/1/2011 **Time:** 2:20 pm

Receiving Water: Rocky River

Approximate Discharge (CFS): 0.07 CFS

Cause: Leaves

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 12/1/2011

Duration of Discharge (Hrs.): 0.50 HRS.

Corrective Action: Removed leaves from leaper by jet rodding inlet

Work Order#: 1126538



4747 East 49th Street

Phone: 216-641-6000 Fax: 216-641-5124

To: Erm Gomes **From:** George Uhl

Ohio EPA

Date: 12-13-2011

Northeast Ohio Regional Sewer District Wet Weather Overflow Notification

☐ Initial Advisory

Five-Day Status Report

Structure: Mill Creek Tunnel Overflow at shaft #3 (Silo) to Mill Creek CSO: N/A

in Harvard Landfill

Date Found: 12/5/11 **Time:**22:15

Receiving Water: Mill Creek

Approximate Discharge (CFS): (Average) 137.5 CFS

Cause: Controlling gates on the Mill Creek Tunnel were closed by Southerly

personnel to protect Southerly WWTP.

Proposed Remedial Action: When rain subsided on 12/6/11; Southerly WWTP

opened the controlling gates.

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 12/6/11

Duration of Discharge (Hrs.): 1.8 Hrs.

Corrective Action:

Work Order#: 1127462



4747 East 49th Street

Phone: 216-641-6000 Fax: 216-641-5124

To: Erm Gomes **From:** George Uhl

Ohio EPA

Date: 12-13-2011

Northeast Ohio Regional Sewer District Wet Weather Overflow Notification

☐ Initial Advisory

▼ Five-Day Status Report

Structure: Mill Creek Tunnel Overflow at shaft #3 (Silo) to Mill Creek CSO: N/A

in Harvard Landfill

Date Found: 12/6/11 **Time:**00:00

Receiving Water: Mill Creek

Approximate Discharge (CFS): (Average) 107.4 CFS

Cause: Controlling gates on the Mill Creek Tunnel were closed by Southerly

personnel to protect Southerly WWTP.

Proposed Remedial Action: When rain subsided on 12/6/11; Southerly WWTP

opened the controlling gates.

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 12/6/11

Duration of Discharge (Hrs.): 2.6 Hrs.

Corrective Action:

Work Order#: 1127463



To: Erm Gomes **From:** George Uhl

Ohio EPA

Date: 12/7/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: D-8, E. 106th and Glenville Ave. **CSO:**230

Date Found: 12/7/2011 **Time:** 12:10PM

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.33 CFS

Cause: Un-known blockage

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 12/7/2011

Duration of Discharge (Hrs.): 1.40 HRS.

Corrective Action: Jet/Vac

Work Order#: 1127023



To: Erm Gomes **From:** George Uhl

Ohio EPA

Date: 12/12/2011

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: MC-16, Broadway Ave. 115' east of E. 94th Street **CSO:**021

Date Found: 12/12/2011 **Time:** 11:25AM

Receiving Water: Mill Creek

Approximate Discharge (CFS): 0.25 CFS

Cause: Sticks and debris in DWO

Proposed Remedial Action: Jet/Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 12/12/2011

Duration of Discharge (Hrs.): 1.50 HRS.

Corrective Action: Jet/Vac

Work Order#: 1114410



To: Erm Gomes From: Charles Cofield

Ohio EPA

Date: 1/11/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CRR-5) Rocky River Dr. & Albers Ave. **CSO:**068

Date Found: 1/10/2012 **Time:** 12:25 p.m.

Receiving Water: Rocky River

Approximate Discharge (CFS): 0.07 CFS

Cause: Leaves blocking leaper

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 1/10/2012

Duration of Discharge (Hrs.): 0.50 Hrs.

Corrective Action: Vacuum leaves from regulator

Work Order#: 1200872



To: Erm Gomes **From:** Wilson Rivera

Ohio EPA

Date: 1/12/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: BC-36 4099 W. 56th ST. (South of Ridgeview Rd.) **CSO:**053

Date Found: 1/11/2012 **Time:** 2:30PM

Receiving Water: Big Creek

Approximate Discharge (CFS): .1443

Cause: Leafs/stick and debris in line.

Proposed Remedial Action: Jet and Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 1/11/2012

Duration of Discharge (Hrs.): 2.50 HRS.

Corrective Action: Jet and Vac, removed debris and stick from line.

Work Order#: 1200989



To: Erm Gomes **From:** Wilson Rivera

Ohio EPA

Date: 1-18-12

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: RR-5 Albers and Rocky River. CSO:068

Date Found: 1/17/2012 **Time:** 3:00PM

Receiving Water: Rocky River

Approximate Discharge (CFS): .0481

Cause: Leaf and debris, build up near outlet.

Proposed Remedial Action: Jet and Vac.

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 1/17/2012

Duration of Discharge (Hrs.): 1.00 HRS.

Corrective Action: Jet and vac, removed debris from outlet.

Work Order#: 1201238



To: Erm Gomes **From:** Wilson Rivera

Ohio EPA

Date: 1/23/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: WR-37A Wset 56th street S. of Denison **CSO:**085

Date Found: 1/18/2012 **Time:** 1:00PM

Receiving Water: Big Creek

Approximate Discharge (CFS): 0.04 CFS

Cause: Sticks in line.

Proposed Remedial Action: Jet and Vac.

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 1/18/2012

Duration of Discharge (Hrs.): 0.50 HRS.

Corrective Action: Removed sticks from line. (Jet and Vac).

Work Order#: 1201585



To: Erm Gomes **From:** Charles Cofield

Ohio EPA

Date: 1/30/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CD-35) Tuscora Ave. & Linn Dr. CSO:230

Date Found: 1/27/2012 **Time:** 2:00 pm

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.36 CFS

Cause: Rags & Debris

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 1/27/2012

Duration of Discharge (Hrs.): 2.00 HRS.

Corrective Action: Jet Rodded 480 feet to down stream manhole

Work Order#: 1201648



To: Erm Gomes From: Charles Cofield

Ohio EPA

Date: 2/1/2012

Northeast Ohio Regional Sewer District
Dry Weather Overflow Notification
Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CD-71A) 1085 Carlyon Rd. CSO:231

Date Found: 1/31/2012 **Time:** 10:30 a.m.

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.04 CFS

Cause: Unknown blockage & sewer grade change

Proposed Remedial Action: Jet and Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 1/31/2012

Duration of Discharge (Hrs.): 1.00 HRS.

Corrective Action: Jet rodded 585 feet to 1st downstream manhole

Work Order#: 1202259



To: Erm Gomes **From:** Charles Cofield

Ohio EPA

Date: 2/10/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: CMC-16) Broadway Ave. 115' east of E.94th Street **CSO:**021

Date Found: 2/10/2012 **Time:** 10:20 A.M.

Receiving Water: Mill Creek

Approximate Discharge (CFS): 0.25 CFS

Cause: Sticks and Debris

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 2/10/2012

Duration of Discharge (Hrs.): 1.50 HRS.

Corrective Action: Jet Rodded 90 feet downstream of regulator

Work Order#: 1202261



To: Erm Gomes From: Wilson Rivera Ohio EPA

Date: 2/22/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: BC-74 Puritas Ave., W. of Grayton Rd. CSO:062

Date Found: 2/22/2012 **Time:** 7:30 AM

Receiving Water: Rocky River

Approximate Discharge (CFS): 0.25 CFS

Cause: Debris in line.

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 2/22/2012

Duration of Discharge (Hrs.): 3.00 HRS.

Corrective Action: Jet and vac line, removed debris.

Work Order#: 1202638



To: Erm Gomes From: Wilson Rivera Ohio EPA

Date: 2/27/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: D-71A 1085 Carlyon Road CSO:230

Date Found: 2/24/2012 **Time:** 1:00 PM

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.04 CFS

Cause: Debris build up in channel.

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 2/24/2012

Duration of Discharge (Hrs.): 0.75 HRS.

Corrective Action: Jet and Vac line, removed debris.

Work Order#: 1204093



To: Erm Gomes From: Charles Cofield

Ohio EPA

Date: 3/15/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CMC-30) Alonzo Ave., W. of East 154th Street **CSO:**027

Date Found: 3/14/2012 **Time:** 9:15 a.m.

Receiving Water: Mill Creek

Approximate Discharge (CFS): 0.32 CFS

Cause: Discarded sampler tubing & debris

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 3/14/2012

Duration of Discharge (Hrs.): 1.00 HRS.

Corrective Action: Jet Rodded 10 feet upstream & downstream of regulator

Work Order#: 1204094



To: Erm Gomes From: Charles Cofield

Ohio EPA

Date: 3/19/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CD-8) E.106th & Glenville CSO:230

Date Found: 3/16/2012 **Time:** 10:10 a.m.

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.36 CFS

Cause: Rags & Debris

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 3/16/2012

Duration of Discharge (Hrs.): 0.50 HRS.

Corrective Action: Jet Rodded 25 feet downstream of regulator to remove debris

Work Order#: 1205162



To: Erm Gomes **From:** Charles Cofield

Ohio EPA

Date: 3/20/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CD-85) Hillcrest Ave. @ Superior Ave. **CSO:**231

Date Found: 3/19/2012 **Time:** 1:00 p.m.

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.14 CFS

Cause: Unknown Blockage

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 3/19/2012

Duration of Discharge (Hrs.): 1.50 HRS.

Corrective Action: Jet Rodded 30 feet upstream of regulator to relieve pipe

Work Order#: 1206061



To: Erm Gomes From: Wilson Rivera Ohio EPA

Date: 4/19/2012

Dry Weather Discharge Advisory

☐ Initial Advisory

☐ Five-Day Status Report

Discharge Location: WR-06 West 3rd and Mary Ave. **CSO:** 086

Date Found: 4/19/2012 **Time:** 9:00AM

Receiving Water: Cuyahoga River

Approximate Discharge (CFS): 0.14 CFS

Description of Problem: Power failure, caused by blown fuse on tranformer. Pumps

out of service during the power failure.

Community with Maintenance Responsibility: City Of Cleveland (WPC).

Contact Person: Rachid Zoghaid

Additional Information: Rachid, contacted the power company and had them replace

the fuse and restore power to the pump station.

Date Corrected: 4/19/2012

Duration of Discharge: 3.00 HRS.

Work Order#: 1208979

NOTE: This is not a dry weather overflow caused by a malfunctioning combined sewer overflow regulator. This discharge, however, is considered an upset pursuant to 40 CFR Part 122.41(n)



To: Erm Gomes **From:** Wilson Rivera

Ohio EPA

Date: 4/19/2012

Northeast Ohio Regional Sewer District
Dry Weather Overflow Notification
Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: D-71-A 1085 Carlyon Rd. CSO:231

Date Found: 4/19/2012 **Time:** 1:00PM

Receiving Water: Dugway Brook

Approximate Discharge (CFS): .0481

Cause: Grease build up in line.

Proposed Remedial Action: Jet & Vac.

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 4/19/2012

Duration of Discharge (Hrs.): 1.50 HRS.

Corrective Action: Used jet rodder to remove grease from line.

Work Order#: 1208744



To: Erm Gomes **From:** Charles Cofield

Ohio EPA

Date: 4/25/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CD-32) Berkshire & Linn Drive CSO:230

Date Found: 4/24/2012 **Time:** 1:05 P.M.

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.25 CFS

Cause: Unknown trash & debris

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 4/24/2012

Duration of Discharge (Hrs.): 1.00 HRS.

Corrective Action: Jet rodded 75 feet upstream of regulator

Work Order#: 1206181



To: Erm Gomes **From:** Wilson Rivera

Ohio EPA

Date: 6/15/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: RR-05 Rocky River Dr. & Albers Ave. CSO:068

Date Found: 6/15/2012 **Time:** 11:30AM

Receiving Water: Rocky River

Approximate Discharge (CFS): 0.04 CFS

Cause: Leaves and debris build up near outlet.

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information:

Date Corrected: 6/15/2012

Duration of Discharge (Hrs.): .50 HRS.

Corrective Action: Vaccum leaves from outlet.

Work Order#: 1210218



Ohio EPA

4747 East 49th Street Phone: 216-641-6000 Fax: 216-641-5120

To: Erm Gomes From: Charles Cofield

Date: 6/18/2012

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

☐ Initial Advisory

☐ Five-Day Status Report

Structure: (CD-85) Hillcrest Ave. at Superior Ave. **CSO:**231

Date Found: 6/15/2012 **Time:** 2:20 P.M.

Receiving Water: Dugway Brook

Approximate Discharge (CFS): 0.07 CFS

Cause: Rags and Debris

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: N/A

Date Corrected: 6/15/2012

Duration of Discharge (Hrs.): 0.50 HRS.

Corrective Action: Jet Rodded 300 feet downstream of regulator to remove blockage

Work Order#: 1206182



To: Erm Gomes From: Charles Cofield

Ohio EPA **Date:** 6/21/2012

Revised Copy

Northeast Ohio Regional Sewer District Dry Weather Overflow Notification Upset Condition Pursuant to Section 40 CFR 122.41(n)

∑ Initial Advisory

☐ Five-Day Status Report

Structure: (CD-87) Stanwood Ave. at Oakwood Ave. **CSO:**211

Date Found: 6/21/2012 **Time:** 11:00 a.m.

Receiving Water: Nine Mile Creek

Approximate Discharge (CFS): 0.07 CFS

Cause: Rock stuck in outlet

Proposed Remedial Action: Jet & Vac

Jurisdiction: NEORSD

Contact Person: Brian Stapleton

Additional Information: Weir wall at CD-88 was removed, sending flow to CSO-211

instead of CSO-232 many years ago.

Date Corrected: 6/21/2012

Duration of Discharge (Hrs.): 0.75 HRS.

Corrective Action: Jet rodded outlet to remove rock

Work Order#: 1213569